

Trailer EBS relay valve with new pressure sensor

Since calendar week 13/2008, a new type of pressure sensor has been installed in the Trailer EBS relay valve 480 207 001 0.

Production date	Pressure sensor product number	Pressure sensor diameter	Pressure sensor spanner width
Until 12/2008	441 044 001 0	Ø 37.5	SW 24
Since 13/2008	441 044 108 0	Ø 30	SW 27

The new pressure sensor 441 044 108 0 is identical to the old one in terms of function; therefore it can also be used when repairing EBS relay valves with a production date before calendar week 13/2008.

Workshop tip:

When the diagnostic software of TEBS 'D' or TEBS 'E' displays a fault message "EBS relay valve / Pressure sensor" the pressure sensor must be replaced along with the following codes:

TEBS D: 62/12, 62/04 or 61/05

TEBS E: 59/12, 59/04 or 58/05

