


Alternative solution for VCS-ECAS Diagnostic Cable

449 622 cable family is no longer available.

This cable is used to transfer the speed information from VCS to ECAS and enable use of the ECAS diagnostic connection for both systems.

The speed info is mandatory for function of ECAS, this is the reason that the old wiring must be repaired.

Alternative for replace the old cable:

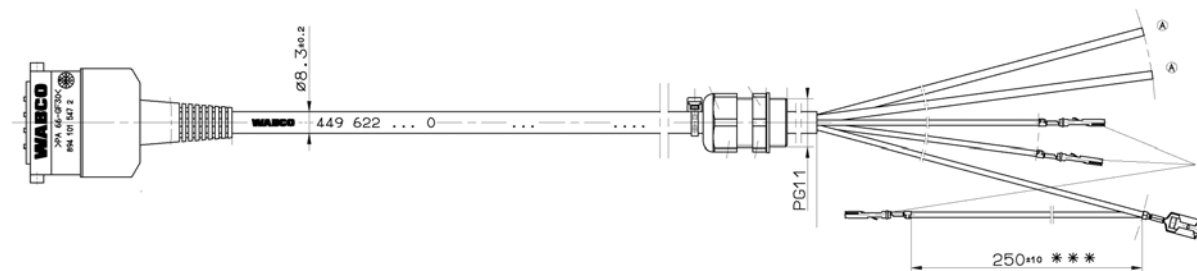

- 1) Purchase usual cable VCS-Diagnostics 449 612 060 0 (or shorter one)
- 2) Cut cable to the desired length
- 3) Purchase new PG fitting 894 130 312 2
- 4) Cut the wires of the damaged cable inside the ECAS Box. Care about enough length for connection.
- 5) Disassemble old cable
- 6) Assemble the cutted cable to the ECAS box, using the PG fitting
- 7) Directly contact the cutted wires. The colours of the wires match between old and new cable.